



POLICE DEPARTMENT  
**LAKE HAVASU CITY**

2360 McCULLOCH BOULEVARD NORTH  
LAKE HAVASU CITY, ARIZONA 86403-5947

To Whom It May Concern:

I hereby attest that Michael T. Maloy, Jr. is a Certified Intoxilyzer Quality Assurance Specialist for the Lake Havasu City Police Department.

I certify that the attached documentation of Standard Quality Assurance Procedures and/or Standard Calibration Check Procedure are full, true and correct copy of the original.

*Michael Maloy Jr #281*  
\_\_\_\_\_  
Signature

STATE OF ARIZONA            )  
  ) ss  
COUNTY OF MOHAVE        )


Subscribed and sworn to before me this 23 day of October.

2024 by Michael Maloy  
\_\_\_\_\_

*Jennifer Leantz*  
\_\_\_\_\_  
NOTARY PUBLIC

10/23/2024  
\_\_\_\_\_  
DATE

Commission expires: 3/15/2025

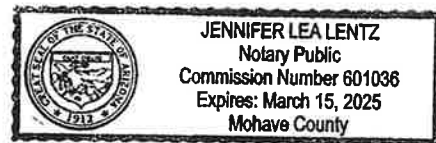

Area Code 928

Administration ..... 855-4884  
Business Office ..... 855-1171  
Investigations ..... 855-5775  
Patrol ..... 855-0515

Fax #'s  
Administration ..... 680-5430  
Business Office ..... 680-5431  
Investigations/Patrol ..... 680-5432

Emergency ..... 9-1-1  
Non-Emergency Dispatch/ ..... 855-4111  
Havasu Silent Witness ..... 854-TIPS

E-mail: police@lhcaz.gov

EXHIBIT I-2

THIS REPORT PREPARED PURSUANT TO DUTY IMPOSED BY A.A.C. R13-10-104 (A)

ARIZONA DEPARTMENT OF PUBLIC SAFETY  
INTOXILYZER MODEL 9000

PERIODIC MAINTENANCE AND STANDARD QUALITY ASSURANCE PROCEDURE

QA SPECIALIST M. MALOY #281 AGENCY LHCPD  
DATE 10-23-2024 TIME 16:35  
INTOXILYZER SERIAL # 90-003696

1. Ensure that gas tank is attached and contains a standard alcohol concentration 0.100 AC

DIAGNOSTIC TESTS

- 1. Clock time check
- 2. Date check

OPERATIONAL TESTS

- 1. Deficient Subject Test (Proper Sample Recognition)  
Deficient Sample printed
- 2. Alcohol-free Subject Test (Proper Sample Recognition):  
0.000 AC
- 3. Mouth Alcohol Subject Test (Proper Sample Recognition):  
Invalid Sample – Begin new deprivation period printed
- 4. Radio Frequency Interference Test (Error Recognition):  
RFI Detect printed
- 5. Standard Calibration Check:  
0.098 AC
- 6. Air Blanks Completed
- 7. Timer Reset

Not a Successfully Completed Test Sequence will be printed

Instrument is operating properly and accurately. YES  NO

COMMENTS: P.S.I.: 825

SIGNATURE Michael Maloy Jr #281

# ARIZONA FORENSIC BREATH ALCOHOL ANALYTICAL REPORT

## INSTRUMENT INFORMATION

Analytical Instrument: Intoxilyzer 9000  
 Serial Number: 90-003696  
 Software Version: 9439.01.00  
 Analytical Report Number: 36961023240060

QAS: MALOY, MICHAEL  
 QAS Permit #: 30178  
 Agency: LAKE HAVASU PD  
 Last 31-Day Check: 09/26/2024  
 Last Annual Maintenance: 01/10/2024

## SUBJECT INFORMATION

Name: 31-Day Check  
 Test Date: 10/23/2024  
 Driver's License #:  
 Gender:  
 Date of Birth:  
 Age:

Weight:  
 State of Issue:  
 Driver's License Expiration:  
 Deprivation Start Time: 16:15  
 15 - Minute Deprivation: Yes

## OPERATOR INFORMATION

Name: MALOY, MICHAEL  
 Agency: LAKE HAVASU PD

Permit #: 30178

## STANDARD INFORMATION

Standard Value: 0.100  
 Standard Lot #: 302-402972207  
 Expiration Date: 02/20/2026  
 Bottle #: 023  
 Last Changed By: MALOY, MICHAEL

Test	g/210L	Time
Air Blank	0.000	16:35:12
Diagnostic Test	PASS	16:35:48
Air Blank	0.000	16:36:25
Calibration Chk	0.098	16:36:46
Air Blank	0.000	16:37:26
Subject Test 1	DEF*	16:40:39
Air Blank	0.000	16:41:29
Air Blank	0.000	16:42:11
Subject Test 2	0.000	16:42:51
Air Blank	0.000	16:43:33
Wait		16:47:36
Air Blank	0.000	16:48:13
Subject Test 3	INV**	16:48:35
Air Blank	RFI***	16:48:49

Permit #: 30178

**RESULTS**

## EXCEPTION MESSAGES

\* Deficient Sample  
 \*\* Invalid Sample - Begin new deprivation period  
 \*\*\* RFI Detect

## OPERATOR COMMENTS

\*Deficient Sample  
 \*\*Invalid Sample - Begin new deprivation period  
 \*\*\*RFI Detect

Not a Successfully Completed Test Sequence

*All air blank results must be 0.000.  
 Consecutive subject test results must not differ by more than 0.020 g/210L.  
 Standard check results must be ±10%.*